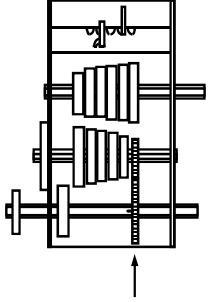
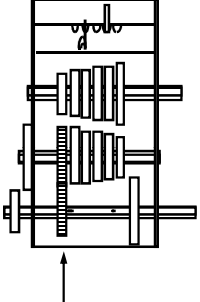
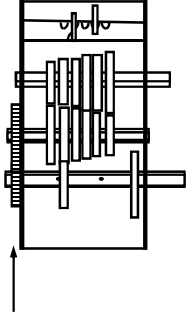


Product Flow Rate Chart in lbs/acre

June 1996

Valmar PT 500

12 groove stainless steel roller, 1/4" gap

*SEED	GEAR BOX SETTING										*PT 500 GEARBOX INPUT RATIO		
	NO. 1		NO. 2			NO. 3		NO. 4		NO. 5			
	A	B	A	B	A	B	A	B	A	B		A	
Wheat	34	37	42	46	51	57	63	70	77	<p>LOW RATIO</p> 			
Oats	23	26	29	32	35	39	43	48	53				
Barley	25	28	31	34	38	42	47	52	57				
Rye	30	33	37	40	45	50	55	62	67				
Sorghum	27	29	33	36	40	45	49	56	61				
Wheat	68.2	74	84	92	102	114	125	141	153	<p>MEDIUM RATIO</p> 			
Oats	47	51	57	63	70	78	86	97	105				
Barley	51	55	62	69	76	85	93	105	114				
Rye	60	65	73	81	90	100	110	123	135				
Sorghum	54	59	66	73	81	90	99	111	121				
Wheat	136	149	167	184	205	227	250	281	307	<p>HIGH RATIO</p> 			
Oats	94	102	115	126	140	156	172	193	211				
Barley	102	111	125	137	153	169	186	210	229				
Rye	120	131	147	162	179	199	219	247	269				
Sorghum	108	118	132	146	162	180	198	223	243				

***IMPORTANT!** To match this chart: Be sure the **GROUND DRIVE RATIO** is set with the **17 TOOTH GEAR DRIVING THE 24 TOOTH GEAR** as shown.

